

Currency: USD

Unit No: 9J091184

City Of Hyattsville

VIN: 1HTWGAZT19J091184
Model: 7400 SBA 6X4
Engine: MAXXFORCE 9 300HP/2200 GOV
Make: International
Delivered: 11/10/2008
In Service: 13 Years 11 Months
Mileage: 97656 Eng Hrs: 15441

Recall/AFC: No

Contact Name: MIKE SCHMIDL
Position: service-primary
Phone:
E-Mail: MSCHMIDL@HYATTSVILLE.ORG
PO Number:

Operation Section A	Labor Cost	Parts Cost	Core Charge	Total Cost
REINSTALL DRIVE SHAFT (1) STRAP KIT, U-JOINT, DRIVE SHAFT, HALF ROUND YOKES, 1710, 1760, 1810	\$89.50	\$52.49	\$0.00	\$141.99

Complaint:	TOWED IN- DRIVE SHAFT REMOVED-EST #3698552
Cause:	Need to replace U-joints when drive shaft is pulled.
Correction:	Not Available

Operation Section B	Labor Cost	Parts Cost	Core Charge	Total Cost
DIAG BLOWN ENGINE FOR REBUILD/REPLACEMENT ESTIMATE	\$358.00	\$0.00	\$0.00	\$358.00

Complaint:	C/S MOTOR IS BLOWN-EST #3698552
Cause:	Unit was torn apart when it got here. Had to check to see what needed replaced for a rebuild.
Correction:	Not Available

Operation Section C	Labor Cost	Parts Cost	Core Charge	Total Cost
Stripped (LONG BLOCK) Service Engine Parts, Transfer [Customer declined repair] (1) ENGINE, TRIMMED REMAN MY08-09 (6) COOLANT, ENGINE, ROTELLA ELC NF 50/50 1GALLON J (8) FLUID,ROTT4TRIPRO10W30CK4 BULK	\$2,327.00	\$41,897.35	\$0.00	\$0.00
Transfer parts to new engine [Customer declined repair]	\$1,790.00	\$0.00	\$0.00	\$0.00

Complaint:	Engine worn out.
Cause:	Customer diagnosed needing an engine
Correction:	Quoted a remanufactured engine

Operation Section D	Labor Cost	Parts Cost	Core Charge	Total Cost
Fuel Injector(S) (ELECTRONIC ENGINES), Replace (1) INJECTOR, ASSY REMAN DT570 I32	\$823.40	\$632.49	\$0.00	\$1,455.89

Works Kit, Install (1) COOLER,KIT, EGR COOLER ASY 330 (1) COOLER,KIT, REMAN EGR COOLER I (1) KT OVRHL,KIT ENGINE OVERHAUL 5 (1) BREATHER,KIT BREATHER ASSEMBLY (1) HOUSING,BREATHER, REMAN SUPPOR (14) BOLT BEARING CAP (12) BOLT CONNECTING ROD (8) COOLANTS,SHELL ROTELLA ELC NIT (8) FLUID,ROTT4TRIPRO10W30CK4 BULK (1) CLAMP EXHAUST PIPE (1) POCKET STAKE RACK (6) RED BRAKLEEN (COB4.10, 5.52)	\$7,518.00	\$14,794.45	\$0.00	\$22,312.45
Machining - Fixed Cost	\$0.00	\$0.00	\$0.00	\$950.00
ROAD TEST	\$179.00	\$0.00	\$0.00	\$179.00
REPLACE CAM LIFTERS AND GASKETS (12) PUSHROD, ENGINE (1) CAMSHAFT AND TAPPETS KIT, ENGINE, I-326 (1) TAPPET,KIT TAPPETS & GUIDES I- (1) THRMOSTA,THERMOSTAT ASSEMBLY (1) COVER,KIT FRONT COVER FRONT HL	\$1,521.50	\$5,116.59	\$0.00	\$6,638.09

Complaint:	<i>Customer says engine is worn out</i>
Cause:	<i>Customer did diagnosis and says the engine is worn out./ During repair tech found Cam, Lifters and Push Rods are worn out and cannot be re-used/ Also found Engine Thermostat broken</i>
Correction:	<i>Install engine rebuild works kit/ Replace Cam, Lifters and Push Rod all related Parts Gaskets required for repair/ Replace Push Rods/ Replace Thermostat</i>

Notes: [7/19/2022 4:17 PM] - Dealer: TOWED IN- DRIVE SHAFT REMOVED-EST #3698552
C/S MOTOR IS BLOWN-EST #3698552

Summary	
Parts:	\$20,596.02
Core:	\$0.00
Labor:	\$10,489.40
Other Items:	\$950.00
Shop:	\$180.00
Tax:	\$0.00
Haz. Waste:	\$2.00
TOTAL:	\$32,217.42

This estimate is subject to teardown and inspection and is valid for 30 days from date above. I, the undersigned, authorize you to perform the repairs and furnish the necessary materials. I understand any costs verbally quoted are an estimate only and not binding. Your employees may operate vehicle for inspecting, testing and delivery at my risk. You will not be responsible for loss or damage to vehicle or articles left in it.

AUTHORIZED BY: _____ DATE: ___/___/___